


РЕЗЬБА ТРУБНАЯ ЦИЛИНДРИЧЕСКАЯ по ГОСТ 6357-81

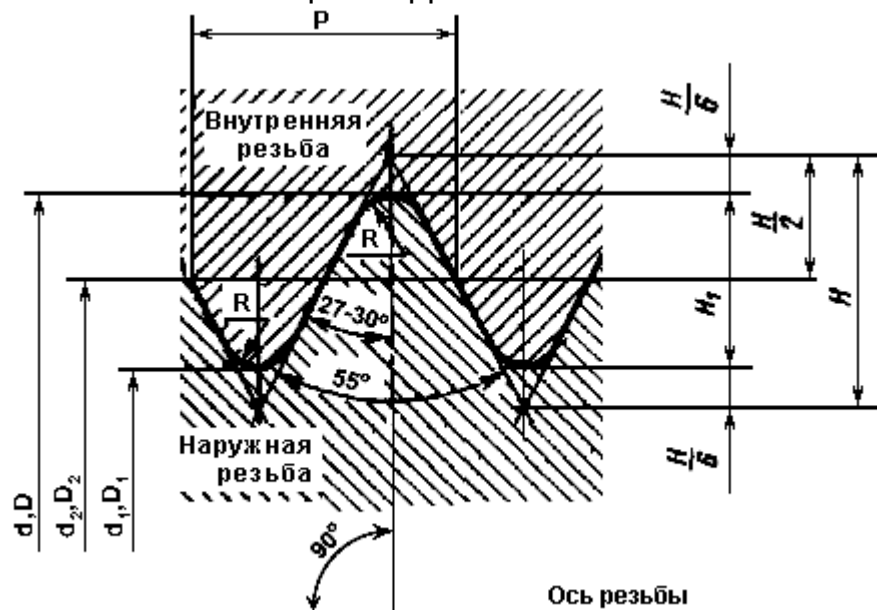

Обозначение размера резьбы		Шаг P	Диаметры резьбы		
Ряд 1	Ряд 2		d=D	d ₂ =D ₂	d ₁ =D ₁
1/16		0,907	7,723	7,142	6,561
1/8			9,728	9,147	8,566
1/4		1,337	13,157	12,301	11,445
3/8			16,662	15,806	14,950
1/2		1,814	20,955	19,793	18,631
3/4	5/8		22,911	25,749	20,587
	7/8		26,441	25,279	24,117
1	1 1/8	2,309	30,201	29,039	27,877
			33,249	31,770	30,291
33,891	36,418		34,939		
1 1/2	1 3/8	2,309	41,910	40,431	38,952
			44,323	42,844	41,365
47,803	46,324		44,845		
2	2 1/4	2,309	53,746	52,267	50,788
			59,614	58,135	56,656
65,710	64,231		62,762		
2 1/2	2 3/4	2,309	75,184	73,705	72,226
			81,534	80,055	78,576
87,884	86,405		84,926		
3	3 1/4	2,309	93,980	92,501	91,022
			100,330	98,851	97,372
106,680	105,201		103,722		
3 1/2	3 3/4	2,309	113,030	111,551	110,072
			125,730	124,251	122,772
138,430	136,951		135,472		
5	4 1/2	2,309	151,130	148,651	148,172
			163,830	162,351	160,872
6	5 1/2				